

Date: Wednesday, 19/11/2008 8:35:39 AM  
 User: Julie Dawson

## Process Sheet

<b>Customer</b> : CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> : 206L FWD X-TUBE
<b>Job Number</b> : 43523	
<b>Estimate Number</b> : 13220	
<b>P.O. Number</b> :	<b>Part Number</b> : D206667103TRN
<b>This Issue</b> : 19/11/2008 <b>S.O. No.</b> :	<b>Drawing Number</b> : D206-667-143 REVB
<b>Prsht Rev.</b> : NC	<b>Project Number</b> : N/A
<b>First Issue</b> : / / <b>Type</b> : CROSSTUBES	<b>Drawing Revision</b> : B
<b>Previous Run</b> : 43522	<b>Material</b> :
<b>Written By</b> :	<b>Due Date</b> : 26/11/2008 <b>Qty:</b> 1 <b>Um:</b> Each
<b>Checked &amp; Approved By</b> : <u>JUD 08.11.19</u>	
<b>Comment</b> : Est Rev:A 08-03-06 new issue DD verified by:ec Est Rev B 08.04.02 removed polish EC verified by DD	

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	D6002115	Crosstube Material
-----	----------	--------------------



**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6002-115 Crosstube B3468P

Check OD = 2.250"; ID = 1.750"

A.M 08.11.250

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand &amp; install plugs DT8534 on both ends as per Folio FA087

2-Turn first side as per Folio FA087

3-File down transition lines smooth.

A.M 08.11.250

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------

**Comment:** INSPECT ALL DIM TO DIM SHEETA.M 08.11.250

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA087

2-File down transition lines smooth.

3-Remove sand and plugs

A.M 08.11.250

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Wednesday, 19/11/2008 8:35:39 AM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L FWD X-TUBE

Job Number: 43523

Part Number: D206667103TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

Qm 08.11.25 ①

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

AWM 8-11-26

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

AWM 8-11-26

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Qm 08.11.26 ①

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock in kanban rack

Location: X-TUBE CELL

AWM 8-11-26

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/11/26 ①

Job Completion



mf 08-11-26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b> 43523
<b>Description:</b> Crosstube Assembly (206L High Fwd)		<b>Part Number:</b> D206-667-143
<b>Inspection Dwg:</b> D206-667-143 <b>Rev:</b> B		<b>Page 1 of 1</b>

### FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.245	/		
	1.982	+0.005/-0.000	1.987	/		
	2.019	+0.005/-0.000	2.024	/		
	2.058	+0.005/-0.000	2.063	/		
	2.097	+0.005/-0.000	2.101	/		
	2.136	+0.005/-0.000	2.141	/		
	2.176	+0.005/-0.000	2.181	/		
	2.201	+0.005/-0.000	2.206	/		
	0.125	+/-0.010	0.125	/		
	0.400 x 30°	+/-0.010	0.400x30°	/		
	R0.063	+/-0.010	R0.063	/		
	R0.500	+/-0.010	R0.500	/		
	4.438	+/-0.030	4.438	/		
SIDE B	104.98	+/-0.020	104.980	/		
	2.240	+0.005/-0.000	2.245	/		
	1.982	+0.005/-0.000	1.987	/		
	2.019	+0.005/-0.000	2.024	/		
	2.058	+0.005/-0.000	2.063	/		
	2.097	+0.005/-0.000	2.101	/		
	2.136	+0.005/-0.000	2.141	/		
	2.176	+0.005/-0.000	2.181	/		
	2.201	+0.005/-0.000	2.206	/		
	0.125	+/-0.010	0.125	/		
	0.400 x 30°	+/-0.010	0.400x30°	/		
	R0.063	+/-0.010	R0.063	/		
	R0.500	+/-0.010	R0.500	/		
	4.438	+/-0.030	4.438	/		

<b>Measured by:</b> a-m	<b>Audited by:</b> A-M	<b>Prototype Approval:</b>	N/A
<b>Date:</b> 08.11.25	<b>Date:</b> 8-11-26	<b>Date:</b>	N/A

Rev	Date	Change	Revised by	Approved
A	04.05.06	New Issue (P/O D206-667-103)	KJ/RF	
B	06.03.09	Dwg Rev updated	KJ/JLM	

Item	Qty -143	Part Number	Description
1	X	D206-667-143	CROSSTUBE ASSEMBLY (206L HIGH FWD)
2	1	D6002-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2891-1	SUPPORT
6	4	D3595-063-395	RUBBER CUSHION
7	4	MS21920-20	CLAMP (OR MS21920-21)
8	14	MS20601AD4W8	RIVET (OR NAS9302B-4-8)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:


- 1) MATERIAL: MANUFACTURED FROM D6002-115  
FINISHED LENGTH = 104.98±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-143" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 15.5 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 10 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2891-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-20 CLAMPS (OR -21) WITH D3595-063-395 RUBBER CUSHIONS TO SECURE THE D2891-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.






SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 43523

RELEASED  
08/11/06

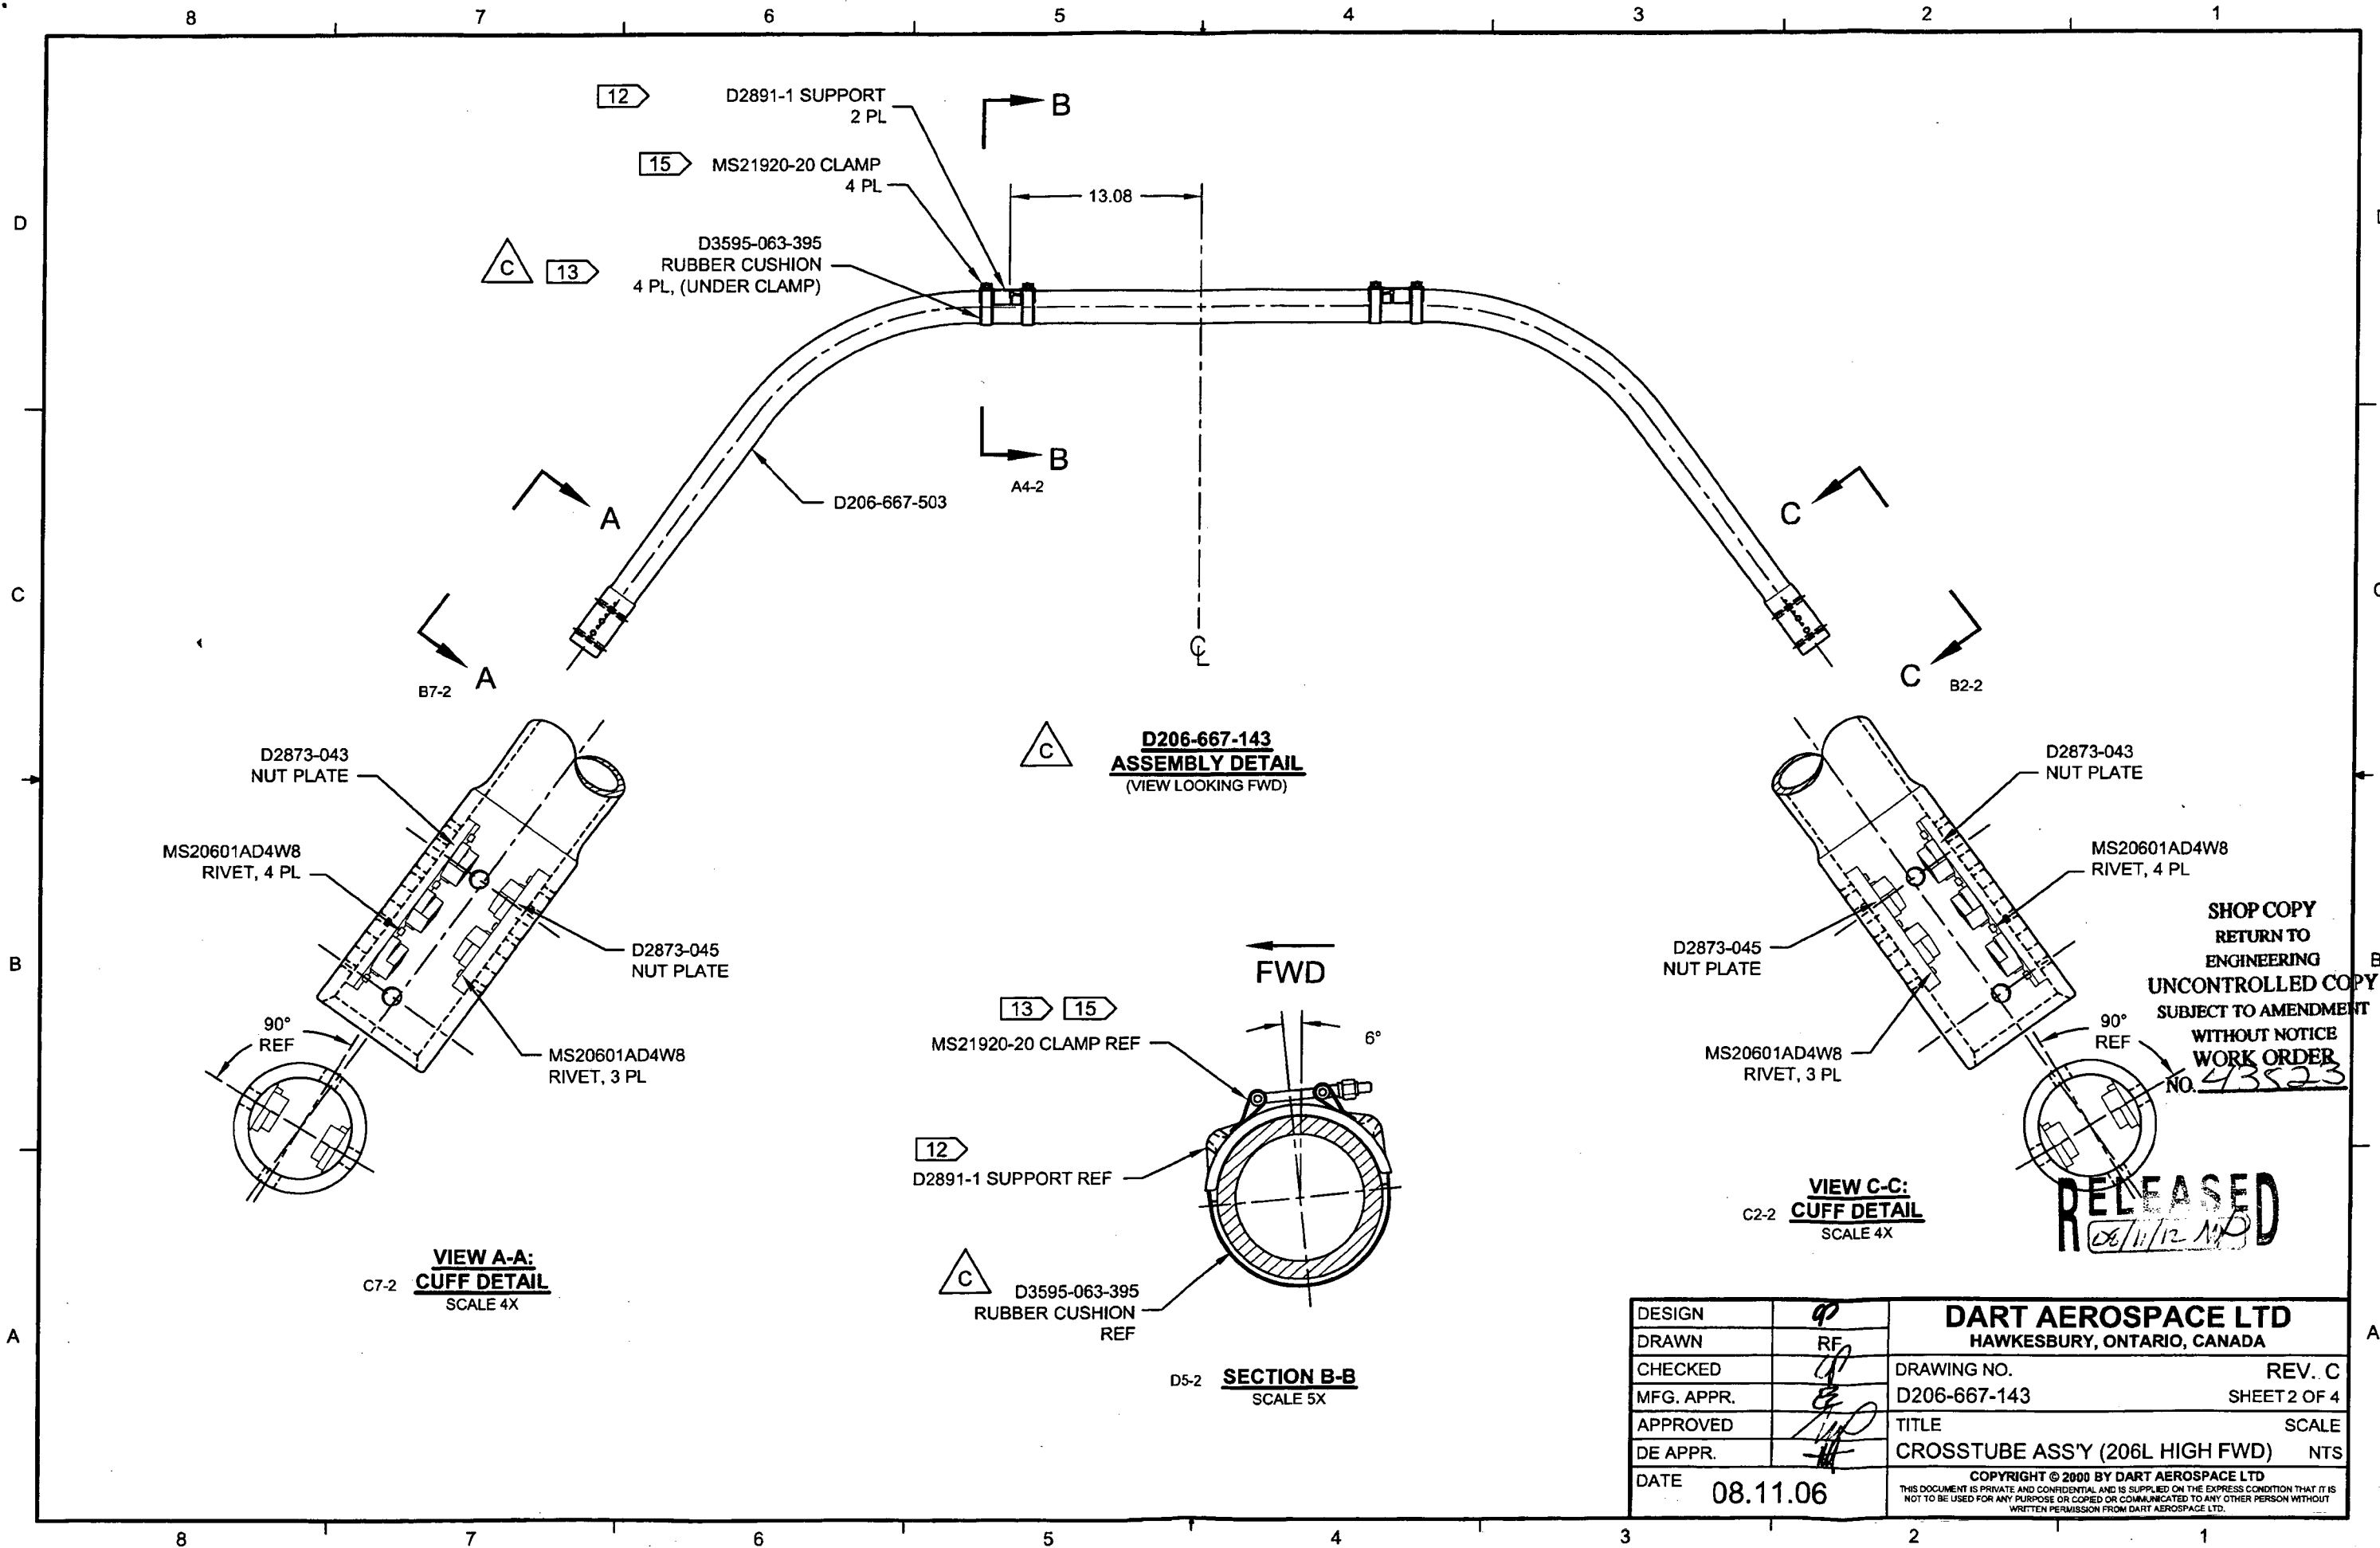C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-395 WAS D2856-400-694 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCE (ZN D3-3, C4-3, C5-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. C
MFG. APPR.	RF	D206-667-143	SHEET 1 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (206L HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


[illegible]



DESIGN		<b>DART AEROSPACE LTD</b>	
DRAWN	RF	<b>HAWKESBURY, ONTARIO, CANADA</b>	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		D206-667-143	SHEET 2 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	




NO  
MOCK CENTER  
MILWAUKEE  
STREET TO VANDERBILT  
UNION TRUSTED CO. A  
STREET  
RETRAIL  
2005 COA

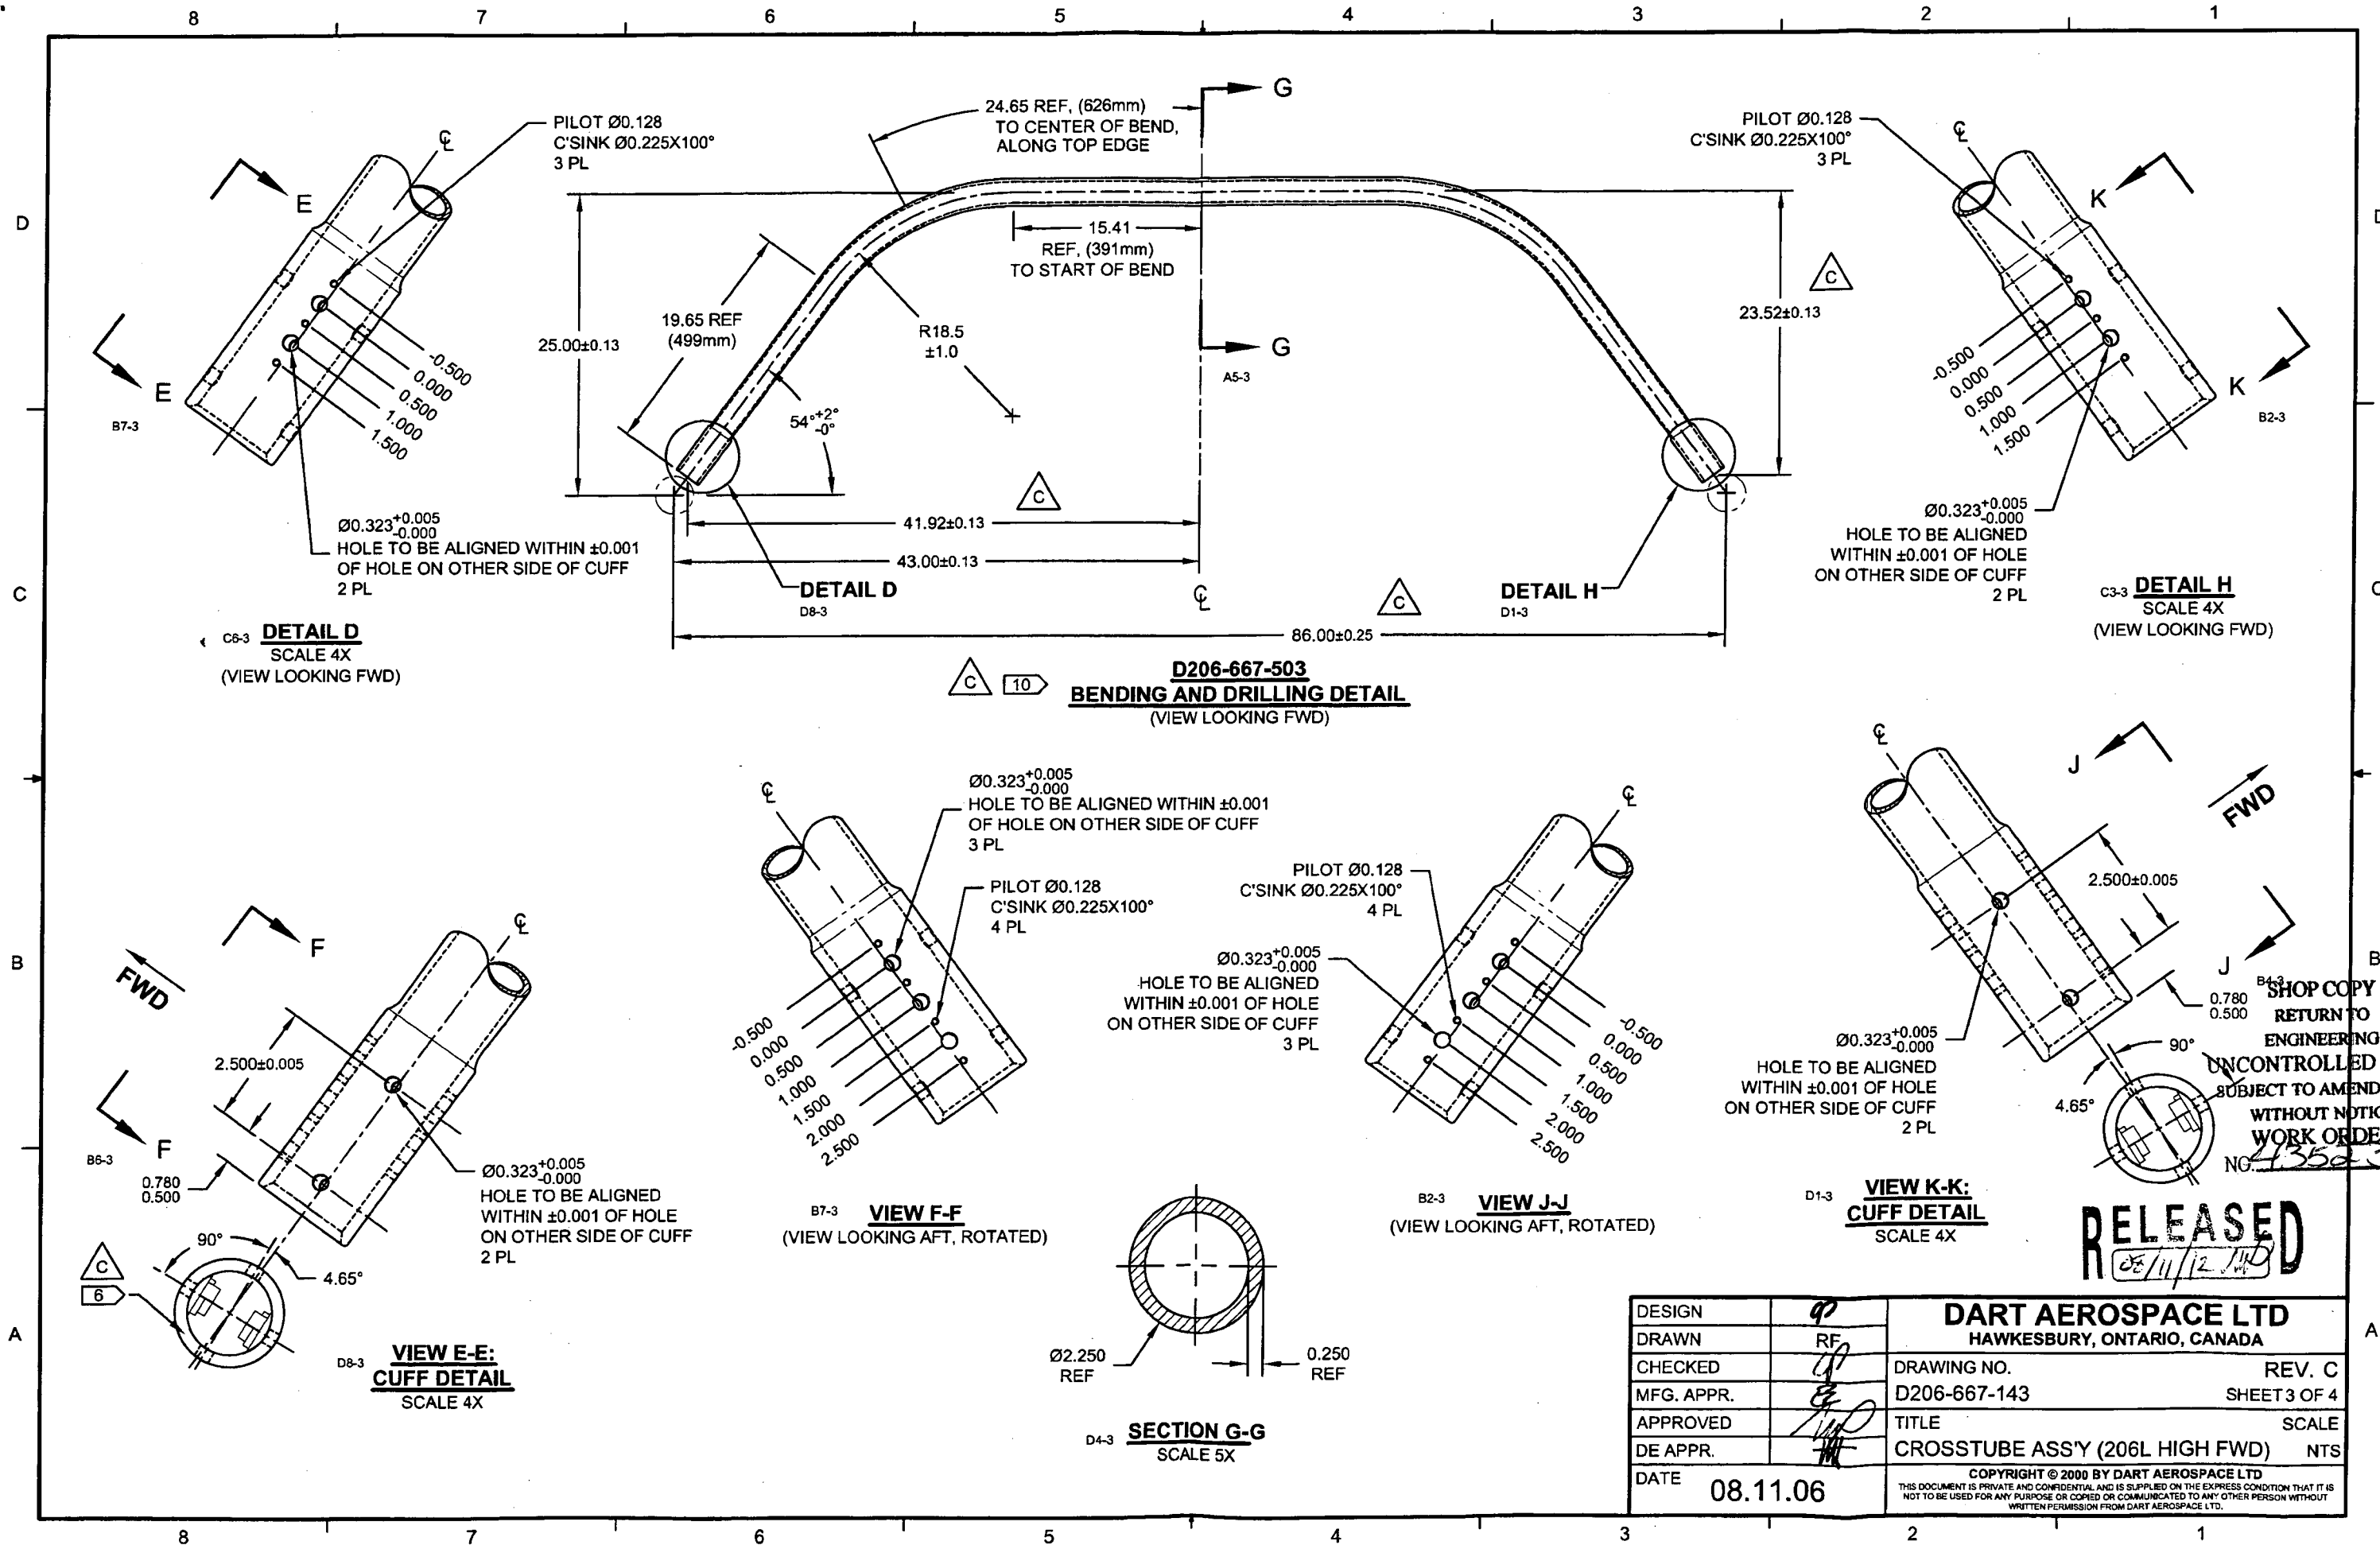


WOMEN OF THE  
NATION IN A  
STRONG POSITION  
TO BECOME  
THE MOST IMPORTANT  
PART OF THE  
NATION TO  
BEHOLD


8 7 6 5 4 3 2 1

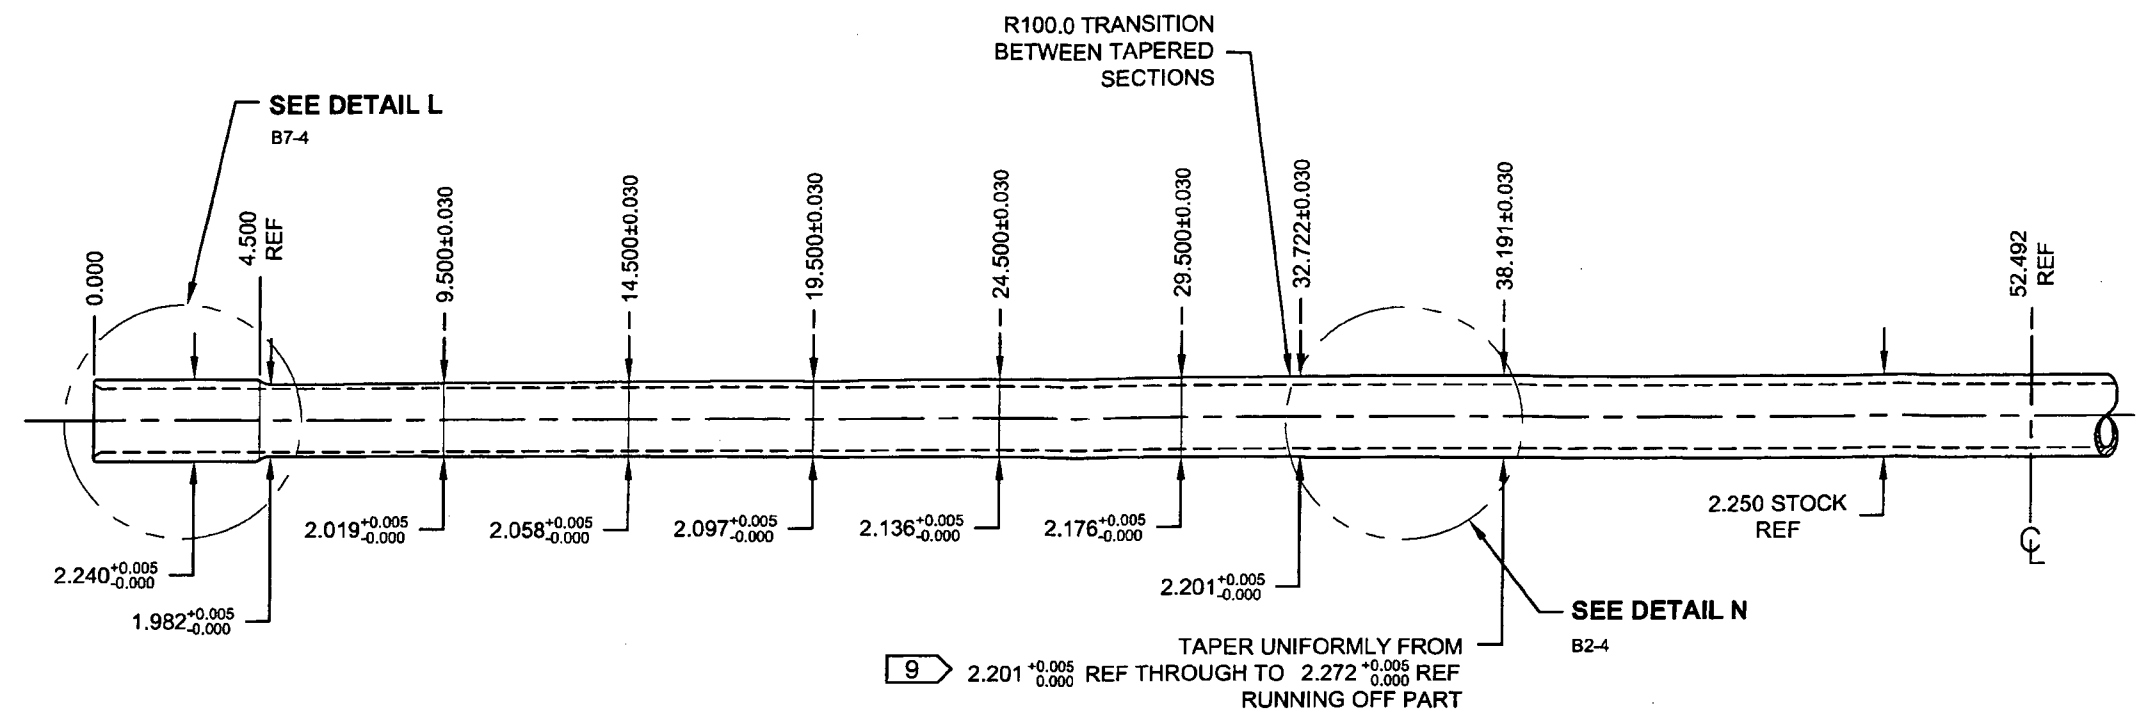


**TURNING DETAIL**

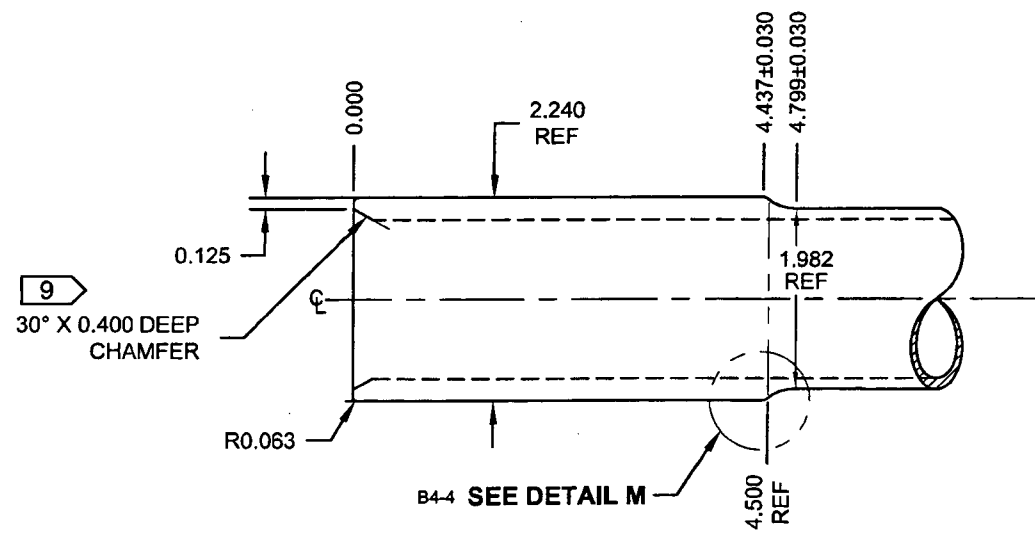

**DETAIL L:**  
D7-4 **CROSSTUBE CUFF**  
NOT TO SCALE

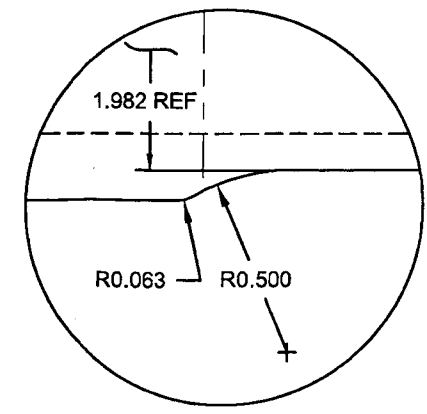

**DETAIL M:**  
A6-4 **CUFF TRANSITION**  
NOT TO SCALE

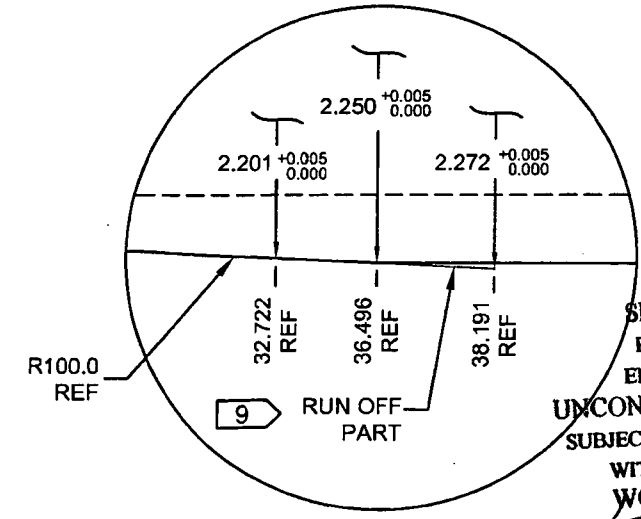

**DETAIL N:**  
C4-4 **TAPER RUN-OFF**  
NOT TO SCALE

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 43523

**RELEASED**

DESIGN	90	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	<b>HAWKESBURY, ONTARIO, CANADA</b>	
CHECKED	90	DRAWING NO.	REV. C
MFG. APPR.	90	D206-667-143	SHEET 4 OF 4
APPROVED	90	TITLE	SCALE
DE APPR.	90	CROSSTUBE ASS'Y (206L HIGH FWD)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

1. DATE  
 2. NAME  
 3. ADDRESS  
 4. CITY  
 5. STATE  
 6. ZIP  
 7. PHONE  
 8. TELETYPE  
 9. FAX  
 10. EMAIL  
 11. TELEFAX  
 12. TELEPHONE  
 13. TELETYPE  
 14. FAX  
 15. TELEPHONE  
 16. TELETYPE  
 17. FAX  
 18. TELEPHONE  
 19. TELETYPE  
 20. FAX  
 21. TELEPHONE  
 22. TELETYPE  
 23. FAX  
 24. TELEPHONE  
 25. TELETYPE  
 26. FAX  
 27. TELEPHONE  
 28. TELETYPE  
 29. FAX  
 30. TELEPHONE  
 31. TELETYPE  
 32. FAX  
 33. TELEPHONE  
 34. TELETYPE  
 35. FAX  
 36. TELEPHONE  
 37. TELETYPE  
 38. FAX  
 39. TELEPHONE  
 40. TELETYPE  
 41. FAX  
 42. TELEPHONE  
 43. TELETYPE  
 44. FAX  
 45. TELEPHONE  
 46. TELETYPE  
 47. FAX  
 48. TELEPHONE  
 49. TELETYPE  
 50. FAX  
 51. TELEPHONE  
 52. TELETYPE  
 53. FAX  
 54. TELEPHONE  
 55. TELETYPE  
 56. FAX  
 57. TELEPHONE  
 58. TELETYPE  
 59. FAX  
 60. TELEPHONE  
 61. TELETYPE  
 62. FAX  
 63. TELEPHONE  
 64. TELETYPE  
 65. FAX  
 66. TELEPHONE  
 67. TELETYPE  
 68. FAX  
 69. TELEPHONE  
 70. TELETYPE  
 71. FAX  
 72. TELEPHONE  
 73. TELETYPE  
 74. FAX  
 75. TELEPHONE  
 76. TELETYPE  
 77. FAX  
 78. TELEPHONE  
 79. TELETYPE  
 80. FAX  
 81. TELEPHONE  
 82. TELETYPE  
 83. FAX  
 84. TELEPHONE  
 85. TELETYPE  
 86. FAX  
 87. TELEPHONE  
 88. TELETYPE  
 89. FAX  
 90. TELEPHONE  
 91. TELETYPE  
 92. FAX  
 93. TELEPHONE  
 94. TELETYPE  
 95. FAX  
 96. TELEPHONE  
 97. TELETYPE  
 98. FAX  
 99. TELEPHONE  
 100. TELETYPE  
 101. FAX  
 102. TELEPHONE  
 103. TELETYPE  
 104. FAX  
 105. TELEPHONE  
 106. TELETYPE  
 107. FAX  
 108. TELEPHONE  
 109. TELETYPE  
 110. FAX  
 111. TELEPHONE  
 112. TELETYPE  
 113. FAX  
 114. TELEPHONE  
 115. TELETYPE  
 116. FAX  
 117. TELEPHONE  
 118. TELETYPE  
 119. FAX  
 120. TELEPHONE  
 121. TELETYPE  
 122. FAX  
 123. TELEPHONE  
 124. TELETYPE  
 125. FAX  
 126. TELEPHONE  
 127. TELETYPE  
 128. FAX  
 129. TELEPHONE  
 130. TELETYPE  
 131. FAX  
 132. TELEPHONE  
 133. TELETYPE  
 134. FAX  
 135. TELEPHONE  
 136. TELETYPE  
 137. FAX  
 138. TELEPHONE  
 139. TELETYPE  
 140. FAX  
 141. TELEPHONE  
 142. TELETYPE  
 143. FAX  
 144. TELEPHONE  
 145. TELETYPE  
 146. FAX  
 147. TELEPHONE  
 148. TELETYPE  
 149. FAX  
 150. TELEPHONE  
 151. TELETYPE  
 152. FAX  
 153. TELEPHONE  
 154. TELETYPE  
 155. FAX  
 156. TELEPHONE  
 157. TELETYPE  
 158. FAX  
 159. TELEPHONE  
 160. TELETYPE  
 161. FAX  
 162. TELEPHONE  
 163. TELETYPE  
 164. FAX  
 165. TELEPHONE  
 166. TELETYPE  
 167. FAX  
 168. TELEPHONE  
 169. TELETYPE  
 170. FAX  
 171. TELEPHONE  
 172. TELETYPE  
 173. FAX  
 174. TELEPHONE  
 175. TELETYPE  
 176. FAX  
 177. TELEPHONE  
 178. TELETYPE  
 179. FAX  
 180. TELEPHONE  
 181. TELETYPE  
 182. FAX  
 183. TELEPHONE  
 184. TELETYPE  
 185. FAX  
 186. TELEPHONE  
 187. TELETYPE  
 188. FAX  
 189. TELEPHONE  
 190. TELETYPE  
 191. FAX  
 192. TELEPHONE  
 193. TELETYPE  
 194. FAX  
 195. TELEPHONE  
 196. TELETYPE  
 197. FAX  
 198. TELEPHONE  
 199. TELETYPE  
 200. FAX  
 201. TELEPHONE  
 202. TELETYPE  
 203. FAX  
 204. TELEPHONE  
 205. TELETYPE  
 206. FAX  
 207. TELEPHONE  
 208. TELETYPE  
 209. FAX  
 210. TELEPHONE  
 211. TELETYPE  
 212. FAX  
 213. TELEPHONE  
 214. TELETYPE  
 215. FAX  
 216. TELEPHONE  
 217. TELETYPE  
 218. FAX  
 219. TELEPHONE  
 220. TELETYPE  
 221. FAX  
 222. TELEPHONE  
 223. TELETYPE  
 224. FAX  
 225. TELEPHONE  
 226. TELETYPE  
 227. FAX  
 228. TELEPHONE  
 229. TELETYPE  
 230. FAX  
 231. TELEPHONE  
 232. TELETYPE  
 233. FAX  
 234. TELEPHONE  
 235. TELETYPE  
 236. FAX  
 237. TELEPHONE  
 238. TELETYPE  
 239. FAX  
 240. TELEPHONE  
 241. TELETYPE  
 242. FAX  
 243. TELEPHONE